

# CHILD RESTRAINT RECALL ANNOUNCEMENTS & SAFETY NOTICES | Revised 10/12/17



This list represents a quick reference tool displaying recalls, defects and safety notices for child restraints that are less than 10 years old. It has been established using information obtained from the Office of Defects Investigation, National Highway Traffic Safety Administration. Contact the car seat manufacturer for more detailed information.

*For questions about the production of this list, contact Washington's Child Passenger Safety project manager at 253-447-3257 or [velezc@ci.bonney-lake.wa.us](mailto:velezc@ci.bonney-lake.wa.us)*

**4MOMS** (last recall 10/31/2016) Thorley Industries LLC, 912 Fort Duquesne Blvd, Pittsburgh, PA 15222 888-614-6667 [www.4moms.com](http://www.4moms.com)

#### Infant Seats

**Self-installing car seat model 1032 made 7/1/16–10/31/16 Problem:** coupling hook may not properly engage, preventing carrier portion from securely attaching to base. In event of crash, carrier can detach, increasing risk of injury. While waiting for replacement 1. Double check carrier is properly locked into base by pulling up on carrier handle before every ride. 2. If carrier doesn't attach to base, use with carrier-only installation; or discontinue use until replacement received. **Call 888-614-6667 or visit [www.4moms.com/recalls](http://www.4moms.com/recalls)** with serial number to determine if affected and replacement carrier is needed.

#### Infant Seats

**City GO Infant Car Seats models BJ64510, BJ64529; Base models BJ80400, BJ61500; City Mini Carseat/Stroller model BJ72510; Vue Lite Carseat/Stroller model BJ70411, BJ70424, BJ70431 made 11/3/14- 4/30/15 Problem:** incorrect or missing information on labels or instructions may cause incorrect use, increasing risk of injury to child. **Call:** 800-241-1848 for free replacement infant car seat.

**AIDIA** (No Recalls) 866-328-8661 [www.aidiaproducts.com](http://www.aidiaproducts.com)

**ANGEL GUARD** (No Recalls) 800-815-6330 x120, [www.angel-guard.com](http://www.angel-guard.com)

**APRICA** (No Recalls) 888-927-7422 [www.aprica.com/enUS](http://www.aprica.com/enUS)

**ARIA CHILD** (No Recalls) [www.ariachild.com](http://www.ariachild.com)

**BABY JOGGER, LLC.** (last recall 4/30/2015) 4111 Premier Drive, High Point, NC 27265 800-241-1848 [www.babyjogger.com](http://www.babyjogger.com)

#### Infant Seats

**City GO Infant Car Seats models BJ64510, BJ64529; Base models BJ80400, BJ61500; City Mini Carseat/Stroller model BJ72510; Vue Lite Carseat/Stroller model BJ70411, BJ70424, BJ70431 made 11/3/14- 4/30/15 Problem:** incorrect or missing information on labels or instructions may cause incorrect use, increasing risk of injury to child. **Call:** 800-241-1848 for free replacement infant car seat.

**BABY TREND INC.** (last recall 7/23/2016) 1607 S Campus Ave, Ontario, CA 91761 800-328-7363 [www.babytrend.com](http://www.babytrend.com)

#### 3-in-1

**Hybrid LX 3-in-1 Centennial booster seat model FB58181 made 7/23/16**

**Hybrid LX 3-in-1 Kiwi booster seat model FB48417 made 7/14/16**

**Problem:** Center adjuster rivet may pull through or break if used with child over 40 lbs, putting child at risk of injury. **Call:** 1-909-773-0018 for seat replacement or full refund.

**TrendZ Fastback 3-in-1 made 10/2011 – 7/2013 models FB60070, FB60408 Problem:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call:** 800-328-7363 or visit [www.babytrend.com](http://www.babytrend.com) for remedy kit.

**BERGERON** (No Recalls) 15 S Second Street, Dolgeville, NY 13329, 800-371-2778 [www.adaptivemail.com](http://www.adaptivemail.com)

**BRITAX** (last recall 5/31/2017) 4140 Pleasant Road, Fort Mill, SC 29708, 888-427-4829, [www.britaxusa.com](http://www.britaxusa.com)

#### Infant Seats

**B-Safe 35 made 10/1/14-7/1/15 Models: B-Safe 35 child seats E9LU65M, E9LU65P, E9LU63F, E9LU66R, E9LS63F, EXLU65M, B-Safe 35 Elite E9LS55T, E9LS56P, E9LS55U, E9LS66C, E9LS65U, B-Safe 35 Travel Systems S914900, S915400, S915200, S921900, S01635200. Problem 1:** car seat handle can crack and break allowing seat to fall unexpectedly, posing risk of injury to child. STOP carrying car seat by handle until repaired. **Visit:** [www.bsaferecall.com](http://www.bsaferecall.com) to register and receive free repair kit. Previously registered products will automatically receive kit. **Problem 2: made 11/1/15-5/31/17 Models: E1A183F, E1A185M, E1A185P, E1A186R, E1A203F, E1A205M, E1A205P, E1A206X, E1A206Z, E1A207E, E9LU65V, E9LU66X, E9LU66Z, E9L67D, E9LU67E, EXA185M, S02063600, S02063700, S03803400, S03803500, S03803700, S03803800, S03803900, S04144400, S04144500, S04144600, S04145000, S04402800, S04884200, S04884300, S04975600, S04978900, S05260200, S06020300, S06020400, S06020500, S06020600, S06020700, S06020800, S06020900, S06147100, S921800** Center tab on chest clip marked 'ABS' may break, causing choking hazard. Continue to safely use car seat after removing chest clip or monitoring center tab until replaced. **Visit:** [www.bsaferecall.com](http://www.bsaferecall.com) or 833-474-7016 for replacement chest clip marked "PC".

**B-Safe 35 Elite** made 11/1/15-5/31/17 Models: E1A215T, E1A215U, E1A216P, E1A221Q, E1A225C, E1A225U, E1A226L, E9LS51Q, E9LS56C, E9LS56L, E9LS57F, E9LS57G, E9LS57H, EXA216L, S01298600, S02063800, S02063900, S02064000, S04281200, S04281300, S04628500, S06018800, S06020000, S06020200, S923700 **Problem:** Center tab on chest clip marked 'ABS' may break, causing choking hazard. Continue to safely use car seat after removing chest clip or monitoring center tab until replaced. **Visit:** [www.bsaf35clip.com](http://www.bsaf35clip.com) or 833-474-7016 for replacement chest clip marked "PC".

**BOB B-Safe35** made 11/1/15-5/31/17 Models: E9LT34A, E9LT34C, E9LT35X, EXLT34A **Problem:** Center tab on chest clip marked 'ABS' may break, causing choking hazard. Continue to safely use car seat after removing chest clip or monitoring center tab until replaced. **Visit:** [www.bsaf35clip.com](http://www.bsaf35clip.com) or 833-474-7016 for replacement chest clip marked "PC".

**Chaperone** made 9/1/10-4/30/11 **Problem #1:** models E9L692J, E9L692K, E9L692L, & E9L692M. The harness adjuster may detach from the shell. Should it detach the harness straps will not properly secure the child resulting in increased risk of injury in a crash. IF the harness adjuster on your Chaperone Infant Car Seat detaches, discontinue use of the product immediately and contact Britax. **Call:** 888-427-4829 for a remedy kit including a harness adjuster clip & instructions for properly installing it. **Problem #2:** made 4/09-5/10 models E9L69N9, E9L69P2, E9L69P3, & EL69P5. Chest clip is brittle & may break causing sharp edges/choking hazard. **Call:** 888- 427-4829 for instructions & new chest clip. If chest clip is broken, remove chest clip & any fragments. Continue to use seat until replacement chest clip is installed.

#### **Convertible Seats**

**Advocate Click Tight** made 8/1/14-7/29/15 Models E9LT95Q, E9LT95Z, E9LT95N, E1A025Q **Problem:** red harness adjuster button may remain down, allowing harness to loosen. If harness straps remain securely tensioned, continue using seat until receipt of remedy kit. If shoulder straps do not remain in place, do not use seat until fixed. Britax sending all registered owners repair kit. **Visit** [www.BritaxClickTightConvertibleRecall.com](http://www.BritaxClickTightConvertibleRecall.com) or **call** 1-888-427-4829 option 3 to register seat and request repair kit.

**Advocate 70-G3** made 6/1/12-8/31/12 Models E9LJ91A, E9LJ91M, E9LJ91S, E9LJ92E, E9LJ93P, E9LJ93S, E9LK91A, E9LK91A, E9LK91A, E9LK31A, E9LK31Q, E9LK32D, E9LK32Z, E9LK33Q, E9LL11A, E9LL11Q, E9LL12D, E9LL12Z, E9LG81A, E9LG83N, E9LG83P, E9LG83X, E9LG83Y, E9LL21A, E9LL23P, E9LL23Y **Problem:** Child chewing on HUGS chest pad may bite off small piece, presenting choking hazard. **Call:** 888-427-4829 for new HUGS chest pads. New HUGS pads are marked "PP" under harness webbing.

**Boulevard Click Tight** made 8/1/14-7/29/15 Models E9LT86F, E1A135Q, E9LT86G, E9LT85Q, E9LT86A, E9LT86H, E9LT85S, E1A015Q, E1A016A, E1A016H **Problem:** red harness adjuster button may remain down, allowing harness to loosen. If harness straps remain securely tensioned, continue using seat until receipt of remedy kit. If shoulder straps do not remain in place, do not use seat until fixed. Britax sending all registered owners repair kit. **Visit** [www.BritaxClickTightConvertibleRecall.com](http://www.BritaxClickTightConvertibleRecall.com) or **call** 1-888-427-4829 option 3 to register seat and request repair kit.

**Boulevard Problem #1:** 70-G3 made 6/1/12-8/31/12 Models E9LJ91A, E9LJ91M, E9LJ91S, E9LJ92E, E9LJ93P, E9LJ93S, E9LK91A, E9LK91A, E9LK91A, E9LK31A, E9LK31Q, E9LK32D, E9LK32Z, E9LK33Q, E9LL11A, E9LL11Q, E9LL12D, E9LL12Z, E9LG81A, E9LG83N, E9LG83P, E9LG83X, E9LG83Y, E9LL21A, E9LL23P, E9LL23Y Child chewing on HUGS chest pad may bite off small piece, presenting choking hazard. **Call:** 888-427-4829 for new HUGS chest pads. New HUGS pads are marked "PP" under harness webbing. **Problem #2:** made 3/1/06- 8/1/06 Model E9L57. In crash, tether hook may open/break & release when used forward facing for child over 50 lbs. If tether breaks, seat may move from upright to reclined position increasing risk of injury. Do not use tether for child over 50 lbs. **Call:** 888-427-4829 for new manual & labels.

**Marathon Click Tight** made 8/1/14-7/29/15 Models E1A116L, E9LT76P, E9LT71Q, E9LT76N, E9LT76B, E9LT75R, E9LT76L, E1A006B, E1A005R, EXA116L **Problem:** red harness adjuster button may remain down, allowing harness to loosen. If harness straps remain securely tensioned, continue using seat until receipt of remedy kit. If shoulder straps do not remain in place, do not use seat until fixed. Britax sending all registered owners repair kit. **Visit** [www.BritaxClickTightConvertibleRecall.com](http://www.BritaxClickTightConvertibleRecall.com) or **call** 1-888-427-4829 option 3 to register seat and request repair kit.

**Pavillion 70-G3** made 6/1/12-8/31/12 Models E9LJ91A, E9LJ91M, E9LJ91S, E9LJ92E, E9LJ93P, E9LJ93S, E9LK91A, E9LK91A, E9LK91A, E9LK31A, E9LK31Q, E9LK32D, E9LK32Z, E9LK33Q, E9LL11A, E9LL11Q, E9LL12D, E9LL12Z, E9LG81A, E9LG83N, E9LG83P, E9LG83X, E9LG83Y, E9LL21A, E9LL23P, E9LL23Y **Problem:** Child chewing on HUGS chest pad may bite off small piece, presenting choking hazard. **Call:** 888-427-4829 for new HUGS chest pads. New HUGS pads are marked "PP" under harness webbing.

#### **Forward Facing Only Seats**

#### **Combination Seats**

**BUBBLEBUM (No Recalls)** 7380 Sandlake Road, Suite 500, Orlando, FL 32819, 800-969-6586, [www.bubblebum.co/us](http://www.bubblebum.co/us)

**CARES (No Recalls)** 800-299-6249 [www.kidsflysafe.com](http://www.kidsflysafe.com)

**CHICCO (last recall 3/17/2008)** 1826 William Penn Way, Lancaster, PA 17601, 877-424-4226, [www.chiccousa.com](http://www.chiccousa.com)

#### **Infant Seats**

**KeyFit & KeyFit 30 Bases Only** made 2/26/08-3/17/08 All models.

**Problem:** Some bases have defect in LATCH attachments. When installed with LATCH webbing used to tighten seat can slip & loosen. **NOTE:** Until repaired install only with vehicle seat belt. **Call:** 800-807-8817 to report defective base and receive envelope. Owner will then cut off LATCH connectors and send in with personal information and will receive new base.

**CLEK (No Recalls)** 12 Upjohn Rd. Suite 1, Toronto, ON M3B2V9 866-656-2462 [www.clekinc.com](http://www.clekinc.com)

**COLUMBIA MEDICAL (No Recalls)** 13577 Larwin Circle, Santa Fe Springs, CA 90670, 800-454-6612, [www.columbiamedical.com](http://www.columbiamedical.com)

**COMBI USA, INC. (last recall 12/5/2012)** 3520 Westinghouse Blvd, Ste B, Charlotte, NC 28273, 800-992-6624, [www.combiusa.com](http://www.combiusa.com)

### Infant Seats

**Centre & Centre ARB made 10/2005-12/2007 Model 8065, 8074, 8086, 8087 & 8520. Problem:** Seat may separate from base in frontal crash. **Call:** 800-543-7734 for retrofit kit. Until repaired, use only without base.

**Shuttle made 10/2005-12/2007 Model 4400, 4515, & 4520. Problem:** Seat may separate from base in frontal crash. **Call:** 800-543-7734 for retrofit kit. Until repaired, use only without base.

### Convertible Seats

**Coccoro Problem 1: made 1/1/2009-6/29/16 Model 8220** Only affects seat's performance when installed forward-facing and secured with vehicle's lap-only belt. Excessive force may be transferred to car seat occupant in event of a crash; increasing risk of injury. **Call:** 888-232-3294 or visit

<http://registration.combiusa.com/recall> for free remedy kit. **Problem 2: made 1/6/2009-12/5/2012** embedded plastic button prevents harness strength from meeting minimum breaking strength when tested independently from child restraint. Could affect overall performance of child restraint in a crash.

**Call:** 844-697-1690 or [www.combiusa.com](http://www.combiusa.com) for free harness replacement kit. Combi encourages use of seat until remedy kit installed.

**Zues 360 made 2/25/2009-5/24/2012 and Zues Turn made 7/15/2007-3/25/2009 Model 8815. Problem:** embedded plastic button prevents harness strength from meeting minimum breaking strength when tested independently from child restraint. Could affect overall performance of child restraint in a crash. **Call:** 844-697-1690 or [www.combiusa.com](http://www.combiusa.com) for free harness replacement kit. Combi encourages use of seat until remedy kit installed.

---

### **COMPASS** (See Tomy International)

---

**CONVAID** (no recalls) 888-266-8243 [www.convoid.com](http://www.convoid.com)

---

### **COSCO** (See Dorel Juvenile Group)

---

### **CYBEX** (last recall 2/2010)

### Booster Seats

**Cyber Solution X-fix made 2/2010 Model 0500200 & 0500760. Problem:** Seats were labeled with incorrect warning related to securing an unoccupied booster increasing risk of an unoccupied booster striking vehicle occupants causing injury in a severe crash. **Call:** 800-593-5522 or visit [www.regallager.com/recall](http://www.regallager.com/recall) for a new warning label and Owner's Manual. *Safety of the seat when used with a properly secured child is not affected.* If the seat is unoccupied, insure it is belted into the vehicle with the vehicle seat belt even when using the LATCH connectors.

---

**DIONO** (last recall 9/5/17) 14810 Puyallup Street, Sumner, WA 98390, 855-GO-DIONO, [www.diono.com](http://www.diono.com)

### Combination, All in One Seats

**Radian R100 made 1/3/14-9/5/17 Model 16600, 16000; R120 made 1/3/14-8/30/17 model 16800, 16000; RXT made 11/25/13-9/5/17 model 16900, 16000**

**Olympia made 4/12/14-3/31/15 Model 30100**

**Pacifica made 4/12/14-5/13/16 Model 30400, 300000**

**Rainier made 4/12/14-9/5/17 Model 30300, 300000**

**Problem:** When seat secured with the lap belt without using top tether, the seat may not adequately protect child and increase risk of chest injury in a crash. Diono will provide remedy kit, updated instruction manual, energy absorbing pad, new chest clip starting 11/22/17. **Call:** 855-463-4666.

---

### **DOONA** (See Simple Parenting)

---

**DOREL JUVENILE GROUP** (last recall 4/25/2012) 2525 State Street, Columbia, IN 47201, 800-544-1108, [www.djgusa.com](http://www.djgusa.com)  
(Cosco/ Eddie Bauer/Maxi-Cosi/ Quinny/Safety 1st)

### Car Beds

#### Infant Seats

All Infant Seats sold as part of a stroller system under Safety 1st, Cosco, Disney, or Eddie Bauer made 1/6/08- 4/6/09. These models, beginning "22-", were sold under the following names and numbers:

**Cosco Sprint: 300 FZN, 300 OSF, 300 CSF, 300 JJV, 300 THD, & 300 TWD**

**Disney Propack: 627 AWF, 355 LBF, 305 NAB, 305 PPH, & 355 PWK**

**Eddie Bauer Adventurer: 627 CGT, 627 FRK, 627 SNW & 627 WPR**

**Eddie Bauer Endeavor: 627 KGS & 655 BYTE.**

**Safety 1st Eurostar: 322 KDL, 322 LXI, 322 OLY, 322 PRS, 322 MAI, & 325 COB.**

**Safety 1st Explorer: 095 RBK.**

**Safety 1st Lite Wave: 380 LGA & 380 MSA.**

**Safety 1st Sojourn: 057 DBY, 085 DWA, 057 CLN, 057 HRT, 322 HRR, 322 PTK, 057 LPH, & 085 LYN.**

**Safety 1st Vector: 627 WAV & 325 PAC**

**Problem:** Handle releases suddenly when carried. Seat may flip & child may fall. **Call:** 866-762-3316 or visit [www.djgusa.com](http://www.djgusa.com) to order handle repair kit. Until installed, do not use handle to carry.

**Comfy Carry made 5/1/11-4/25/12 Model IC123 FSM. Problem:** Some seats were sold without lower LATCH attachment strap. **Call:** 877-416-8111 for replacement base with LATCH. Until new base is received consumers should use the seat installed with a seat belt.

**Maxi-Cosi Mico made 5/1/08- 4/30/09 Problem #1: Models begin "22-" 371CIP, 371CTR, 371FSB, 371LYP, 371MJR, 371PHT, 371RFR, 371TRL, & 372TTH.** Harness may gradually loosen during normal use increasing risk of injury in crash. Until repaired double check to assure harness is adjusted snugly around child. **Call:** 866-623-3139 or email [consumer@djgusa.com](mailto:consumer@djgusa.com) for repair kit. **Problem #2: made 7/1/07-6/28/08 Models 22-371, 22-372, & Separate Base 22-515.** Carrier may not attach properly to base. If carrier is not properly attached child could be injured in crash. Until fixed check connection by pulling up on carrier to assure engagement with base. **Call:** 877-657-9546 or visit safety notices at [www.djgusa.com/safety\\_notice/](http://www.djgusa.com/safety_notice/). **OnBoard made 5/1/08- 4/30/09 Models begin "22-" 077FSM, 078DMS, 346VAL, 356NTR, 356PRO, 356TRI, 657FRK, 657MTT, 657PST, 657SNW, 657SON, & 657VND also model IC-072SON.** Problem: Harness may gradually loosen during normal use increasing risk of injury in crash. Until repaired double check to assure harness is adjusted snugly around child. **Call:** 866- 623-3139 or email [consumer@djgusa.com](mailto:consumer@djgusa.com) for repair kit. **OnBoard 35 made 5/1/11-4/25/12 Model IC124 FSM.** Problem: Some seats were sold without lower LATCH attachment strap. **Call:** 877-416-8111 for replacement base with LATCH. Until new base is received consumers should use the seat installed with a seat belt.

#### Convertible Seats

**Alpha Omega Elite, Complete Air LX, Complete Air SE, Deluxe 3-in-1 made 7/20/10-5/18/11 Models 22187ANL, 22187REM, 22187REMA, 22187SAR, 22187SARA, 22465FSM, CC033BMT, CC043ANK, CC043ANL, CC043AQS, CC046AAI, CC046AAU, CC046CTA, CC046SNW, CC046WPR, CC050AJH, CC050ANY, CC050ANZ, CC050AOQ, CC051AIR, 22790CGT.** Problem: Labeling of rear-facing belt path is incorrect. May result in confusion and incorrect installation. **Call:** 877-675-2355, or email [rfbaselabel@djgusa.com](mailto:rfbaselabel@djgusa.com) for free label kit.

**Alpha Omega, Alpha Omega Elite, Enspira, Maxi-Cosi Priori, Prospect, & Vantage made 5/1/08-4/30/09 Models begin "22-" 148RDH, 149PAL, 150BNS, 152BVL, 152CMN, 152RGS, 154HTR, 155BDF, 155HMR, 155NSHE, 155OTC, 155TRP, 158BLL, 158GRS, 158SPA, 159SGT, 172BKE, 172BRT, 172OKW, 172PHO, 172SVT, 177SNP, 177SNP2, 178SCT, 178STL, 178VSS, 185BVL2, 188BVL2, 195SVS, 195SVS2, 412, 439ABY3, 439HTP3, 439OKP3, 439VNS3, 449GES, 452RBYE, 453BCT, 453FSM, 456BVL, 456CAB, 456CAO, 456CSR, 456LMT, 456MIL, 456MRR, 456NTM, 456NTR, 456PRO, 456SCY, 456SUZ, 456TRI, 456TTN, 458FTM, 458NYC, 459MTG, 462BLN, 465BMT, 469BSE, 469BSEC, 475BVL, 476CIP, 476CTR, 476FSB, 476GIP, 476ISP, 476NOW, 476NRF, 476PHT, 476PMK, 476PNG, 486CRI, 486GIP, 486TTH, 546BSE, 547CHA, 553BVL3, 554PCR, 554PCR3, 554RCR3, 561WAL, 564ARZ, 564MIL, 564NTR, 564OKW, 564PHO, 564PRO, 564TRI, 564VLC, 567GRH, 574PCR3, 580BYR, 740HPN, 741ATI, 741BWD, 741GRT, 741, 755BLD, 758BYT, 758CMP, 758FRK, 758HDS, 758HID, 758KGS, 758PST, 758SNW, 758SON, 758VND, 759MTT, 790CGT, 790SNW, 790WPR, 790WPR2, 799MER, 880BYT, 880MTT, 880MTTA, 880SON, 880SONA, & 560FSM also models 93- 560FSM, 17-439ABY, & 17-439HTP.** Problem: Harness may gradually loosen during normal use increasing risk of injury in crash. Until repaired double check to assure harness is adjusted snugly around child. **Call:** 866-623-3139 or email [consumer@djgusa.com](mailto:consumer@djgusa.com) for repair kit.

#### Booster Seats

.....  
**DREAM ON ME (no recalls) 732-748-1300 [www.dreamonme.com](http://www.dreamonme.com)**  
.....

**EDDIE BAUER (See Dorel)**  
.....

**EVENFLO COMPANY INC. (last recall 2/9/2016) 1801 Commerce Drive, Piqua, OH 45356, 800-543-8954 [www.evenflo.com](http://www.evenflo.com)**  
.....

#### Infant Seats

**Discovery made 2/4/08 Model 3021769Z & 3021854Z Problem #1:** (Note: All sold at Target & Wal-Mart Stores.) Seat may have shipped without complete assembly of red release handle. Under certain conditions, this may cause seat to separate from base resulting in serious injury. **Call:** 800-233-5921 for replacement seat & base. Until replaced install seat only without base. **Problem #2: made 4/1/05-1/31/08 Models beginning 390, 391, 534, & 552.** Seat could separate from base in high impact side crash. **Call:** 800-356-2229 for supplemental dual hook fastener.

**Embrace35 made 12/1/2011-5/31/2013 Model 30711365, 31511040, 31511323, 31511400, 3151198, 3151953, 31521138, 46811205, 46811237, 48111200, 48111215, 48111215A, 48111218, 48111234, 48111235, 48111235A, 48111462, 48411391, 48411391D, 48411392, 48411504, 48411504D, 52911307A, 52921040, 55311138, 55311238, 55311292** Problem: harness buckle may become difficult to unlatch over time, making it challenging to remove child from seat. **NOTE:** not all models in this list are impacted. **Call 800-490-7591 or go to [www.embracebuckle.evenflo.com](http://www.embracebuckle.evenflo.com) to determine if your seat is affected and obtain a free remedy kit.**

**First Choice made 1/16/09-9/29/09 Model 3604098.** Problem: Mandatory information may be missing from product labels. **Call:** 800-233-5921 for replacement labels.

#### Convertible Seats

**Momentum (65, 65 LX, 65 DLX) made 3/4/2013 – 8/26/2013 Models beginning with "385".**

**SureRide DLX made 6/20/2012 – 10/17/2013 Models beginning with "371".**

**Titan 65 made 6/20/2012 – 10/17/2013 Models beginning with "371".**

Problem: May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call: 800-490-7591 for new buckle or order online at [www.buckle.evenflo.com](http://www.buckle.evenflo.com)**

#### Combination, All in One Seats

**Chase, Chase LX, Chase Select made 6/12/2012 – 10/3/2013 Models beginning with "306"; and Chase LX, Chase DLX made 8/23/2011 – 3/3/2014 Models beginning with "329".** Problem: May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call: 800-490-7591 for new buckle or order online at [www.buckle.evenflo.com](http://www.buckle.evenflo.com)**

**Evolve 3-in-1 made 2/26/15 – 2/9/16 model number 34411700 AND made 5/27/15 – 2/9/16 model number 34411741.** Problem when used with harness, child may access button and loosen harness and increase risk of injury. Do not use seat with harness if child is loosening harness. **Call:** 800-233-5921 or [www.evolve.evenflo.com](http://www.evolve.evenflo.com) for remedy kit.

**Maestro and Maestro Performance made 8/22/2011 – 10/17/2013 Model number begins with "310".** Problem #1: May experience difficulty

unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call: 800-490-7591 for new buckle or order online at [www.buckle.evenflo.com](http://www.buckle.evenflo.com) Maestro made 11/24/09-4/9/10 Model numbers begin “310” Problem #2:** In a crash, crack may form at front of seat causing child to not be properly restrained. **Call: 800-233-5921** for a reinforcement kit. Children weighing less than 40 lbs should use a different seat until repaired. Those weighing more than 40 lbs may continue to use the seat as a booster until repaired.

**Secure Kid (LX, DLX, 100, 300 and 400) made 12/13/2011 – 3/3/2014 Models beginning with “308”. Problem:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call: 800-490-7591 for new buckle or order online at [www.buckle.evenflo.com](http://www.buckle.evenflo.com)**

**Snugli Booster made 12/13/2011 – 3/3/2014 Models beginning with “308”. Problem:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call: 800-490-7591 for new buckle or order online at [www.buckle.evenflo.com](http://www.buckle.evenflo.com)**

**Snugli All-in-One made 10/2/2012 – 8/26/2013 Models beginning with “345” or “346”.**

**Symphony (65, 65 E3, LX and DLX) made 10/2/2012 – 8/26/2013 Models beginning with “345” or “346”.**

**Problem:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call: 800-490-7591 for new buckle or order online at [www.buckle.evenflo.com](http://www.buckle.evenflo.com)**

**Transitions 3 in 1, made prior to 1/29/16 Models 34411686, 34411695, 34411029 Problem:** Child can access central front adjuster (CFA) resulting in a loose harness and increasing risk of injury. Do not use seat with harness if child is accessing CFA area. Seat may be used safely as booster for child 40 pounds and 43.3 inches. Discontinue use until repaired if child does not meet booster requirements and is accessing CFA area. **Call: 800-233-5921** or [www.transitions.evenflo.com](http://www.transitions.evenflo.com) for remedy kit.

#### **Booster Seats**

**Big Kid Model 30911173AD, 3091967AD, 30911118AD & 30911120D Problem:** Small number of seats intended for display were incorrectly shipped to institutional customers. Seats were shipped between 8/6/12-9/18/12. Affected units have a label stating: “DISPLAY ONLY” NOT INTENDED FOR SALE, on the back of headrest. These units meet all crashworthiness standards. **Call: 800-233-5921** for instruction manual, registration card, and label.

---

**E-Z-ON PRODUCTS (No Recalls)** 605 Commerce Way West, Jupiter, FL 33458, 800-323-6598, [www.ezonpro.com](http://www.ezonpro.com)

---

**FIRST YEARS, THE (See Tomy International)**

---

**GOBOOSTER (no recalls)** 888-327-4336 <http://gobooster.co.za>

---

**GOOD BABY USA (no recalls)** 844-543-2020, [www.gbchildusa.com](http://www.gbchildusa.com)

---

**GRACO (last recall 4/5/2016)** 150 Oaklands Blvd Exton, PA 19341, 800-345-4109, [www.gracobaby.com](http://www.gracobaby.com)

#### **Infant Seats**

**Aprica A30 made 7/1/11 – 4/30/12**

**Problem:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call: 877-766-7470** for replacement buckle or [www.gracobucklerecall.com](http://www.gracobucklerecall.com)

**SnugRide, SnugRide Classic Connect made 3/1/11 – 5/31/13**

**SnugRide 30, SnugRide Classic Connect 30 made 7/1/10 – 1/31/13**

**SnugRide 35, SnugRide Classic Connect 35 made 5/1/11 – 1/31/13**

**SnugRide Click Connect 40 made 6/1/12 – 12/31/12**

**Problem #1:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call: 877-766-7470** for replacement buckle or [www.gracobucklerecall.com](http://www.gracobucklerecall.com)

#### **Convertible Seats**

**Classic Ride 50 made 10/1/2011 – 9/30/2013 Problem #1:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call: 800-345-4109** for replacement buckle **Problem #2: Model 1812930 3/1/2014 - 2/28/2015** Missing information on location of manufacturer’s instructions. **Call: 800-345-4109** for replacement label. [consumerservices@gracobaby.com](mailto:consumerservices@gracobaby.com)

**Cozy Cline Toddler Safe Seat Step 2 made 1/1/2006 – 4/30/2010**

**Problem:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call: 800-345-4109** for replacement buckle or [consumerservices@gracobaby.com](mailto:consumerservices@gracobaby.com)

**Comfort Sport made 10/1/2010 – 9/30/2013 Problem #1:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call: 800-345-4109** for replacement buckle or [consumerservices@gracobaby.com](mailto:consumerservices@gracobaby.com) **Problem #2: made 11/1/2006- 10/08/2007 Models 8C04FRR & 8C04FRR2.** Seat has large “body pillow” that partially covers airbag warning label. **Call: 800-345-4109** Graco will instruct consumer to discard body pillow which is for comfort only & does not affect safety of seat. **Problem #3: made 1/2/07-7/31/07 Models 8629TWL, 8630MTR, 8631DFT, 8631DRA, 8632PSO, 8635TAC, 8639COS, 8C00BLG, 8C00DMN, 8C00GRP, 8C00LNW, 8C00MID, 8C00TMB, 8C01SVD, 8C01WTN, 8C02MGI, 8C02MRC, 8C03HAL, 8C03WCF, 8C04FRR, & 8433FOF.** Some seats may have Lower Anchor belt misrouted causing seat to exceed safe angle in crash. Do NOT use LATCH to install seat rear-facing until repaired! Instead use seat belt. **Call: 800-345-4109** for instructions. **Problem #4: Made 3/1/2014 - 2/28/2015 Model 1794333,**

**1813040** Missing information on location of manufacturer's instructions. **Call:** 800-345-4109 for replacement label.  
**Extend2Fit made 11/27/2015 – 1/20/2016 Model 1954477 Problem:** Recline label affixed incorrectly, may result in wrong angle position. Seat should have all English labels on one side; and Spanish on other. If labels are mixed languages on one side, obtain new label. **Call:** 800-345-4109.

**Head Wise 70 with Safety Surround made 1/1/2012 – 7/31/2013; and 8/3/2013 Problem:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call:** 800-345-4109 for replacement buckle or consumerservices@gracobaby.com

**Milestone made 7/9/15 - 10/9/15 models 1910130, 1923980, 1926538, 1926539 Problem:** Labels do not have required wording about how to install seat with LATCH or seat belt per FMVSS 213. Recall does not affect safety performance. Registered owners will be sent a new label or **Call:** 800-345-4109

**My Ride 65, My Ride 65 with Safety Surround made 4/1/2009 – 7/31/2013; and 9/30/2013 Problem 1:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Problem 2: must have webbing tag code 2014/06 AND model 1794334 (made 5/20/14 - 7/15/14), 1813015 (7/3/14 - 7/24/14), 1813074 (6/20/14 – 7/27/14), 1853478 (7/11/14 – 7/27/14), 1871689 (7/5/14 – 7/24/14), 1872691 (5/16/14 – 8/1/14), 1877535 (5/26/14 – 7/27/14), 1908152 (7/23/14 – 7/27/14)** Harness webbing doesn't meet federal requirements. May not adequately restraint child resulting in increased risk of injury in a crash. **Call:** 800-345-4109 for replacement parts or consumerservices@gracobaby.com

**My Ride 70 made 5/1/2012 – 7/31/2013**

**My Size 70 made 1/1/2012 – 7/31/2013; and 8/3/2013 Problem:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call:** 800-345-4109 for replacement buckle or consumerservices@gracobaby.com

**Ready Ride made 10/1/2010 – 9/30/2013 Problem #1:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call:** 800-345-4109 for replacement buckle or consumerservices@gracobaby.com **Problem #2: Made 3/1/2014-2/28/2015 Model 1924519, 1924520** Missing information on location of manufacturer's instructions. **Call:** 800-345-4109 for replacement label.

**Size4Me 70 made 1/1/2012 – 7/31/2013; and 8/3/2013 Problem:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call:** 800-345-4109 for replacement buckle or consumerservices@gracobaby.com

**Smart Seat and Smart Seat with Safety Surround made 12/1/2010 – 9/30/2013; and 10/9/2013, 12/25/2013, 1/10/2014**

**Problem:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call:** 800-345-4109 for replacement buckle or consumerservices@gracobaby.com

#### **Combination Seats**

**Argos 70, Argos 70 Elite made 5/1/2011 - 7/31/2013**

**Nautilus 3-in-1, Nautilus Elite, Nautilus Plus made 10/1/2007 – 7/31/2013; and 8/19/2013**

**Problem:** May experience difficulty unlatching harness buckle; buckle may become stuck – increasing risk of injury if prompt exit of vehicle is required. Does not affect performance of car seat or buckle to restrain the child. **Call:** 800-345-4109 for replacement buckle or consumerservices@gracobaby.com

**CarGo, Platinum CarGo, Treasured CarGo, & Ultra CarGo made 1/9/2007-3/3/2008 Models 8487BELI, 8487SMP, 8487WBR, 8686ROS, 8689FAR, 8D01ZPH, 8D02SYC, 8D03WIK, 8D04SDN, 8D05NWX, & 8D10CCE. Problem:** NHTSA Hotline phone number on label affixed to seat back may be incorrect. Should read 888-327-4236. **Call:** 800-345-4109 for sticker kit.

#### **Booster Seats**

**Turbo model 1963973 made 3/8/16-4/2/16; 1963974 made 12/22/15-3/30/16; 1963975 made 12/22/15-3/17/16; 1963976 made 2/17/16-3/24/16; 1967886 made 1/13/16-4/5/16; 1975173 made 3/29/16. Problem:** Owner's manual left out instruction to secure booster seat when not in use. This does not affect performance of seat in a crash. Obtain missing printed instructions by calling 800-345-4109.

.....  
**HARMONY JUVENILE PRODUCTS (No Recalls)** 1600 53rd Street, North Bergen, NJ 07047, 877-306-1001, [www.harmonyjuvenile.com](http://www.harmonyjuvenile.com)

.....  
**HAUCK FUN FOR KIDS (No Recalls)** 905-455-5888 [www.hauckuk.com](http://www.hauckuk.com)

.....  
**IMMI (See Safe Guard)**

.....  
**JANE (no recalls)** 866-890-3071 [www.jane-usa.com](http://www.jane-usa.com)

.....  
**KIDDY (last recall 5/1/13)** 685 Dividend Drive, Suite 100, Peachtree City, GA 30269, 855-925-4339, [www.kiddyusa.com](http://www.kiddyusa.com)

#### **Combination Seats**

**World Plus model 51 100 WP made 2/1/12-5/1/13 Problem:** When using seat with shield, buckle/tongue may not fully engage; not adequately restraining child in a crash. **Call:** 855-925-4339 to arrange for return of seat and reimbursement of purchase price.

.....  
**KIDS EMBRACE (no recalls)** 866-947-3287 [www.kidsembrace.com](http://www.kidsembrace.com)

**LAMAZE** (See Tomy International)

---

**LEARNING CURVE** (See Tomy International)

---

**LIL FAN** (no recalls) 317-804-9160 www.liifan.com

---

**MAXI-COSI** (See Dorel Juvenile Group)

---

**MERRITT MANUFACTURING** (No Recalls) PO Box 17152, Indianapolis, IN 46217, 317-409-0148, www.eztether.com

---

**MIA MODA, INC./LARADO** 1 Meridian Blvd, Wyomissing, PA, 19610, 866-MIA-MODA, www.miamodainc.com

---

**Infant Seats**

**Mia Moda Viva and Viva Supreme Model 5000, 5001, 5050, 5051, 5070, 5071, 5080, & 5081.** Problem: Harness splitter plate on rear of seat has sharp edges & may cut harness OR base may crack in crash. In crash child would not be properly restrained. Call: 877-546-8437. Immediately stop using the seat. Manufacturer will offer refund.

---

**NANIA** (See Team-Tex)

---

**NUNA** (No recalls) 70 Thousand Oaks Blvd., Morgantown, PA 19543, 610-913-5100, www.nuna.eu/USA

---

**ORBIT BABY** (last recall 7/20/2013) 5437 Central Ave, Ste 10, Newark, CA 94560, 877-ORB-BABY, www.orbitbaby.com

---

**Infant Seat**

**Orbit Baby Car Seat Bases Problem #1: G2 bases made between 3/20/13 - 7/20/13. Model ORB822000. Batch Number A0840, A0860 or A0880.** StrongArm Knob may detach or spin without tightening the base preventing proper installation. Register seat at [www.orbitbaby.com](http://www.orbitbaby.com), call 877-ORBBABY to receive free StrongArm Repair Kit. If seat is not already tightly installed, use the car seat without the base until fixed. **Problem #2: All Orbit Baby Bases made pre- 2/2008.** Base must be upgraded for use w/ Toddler Car Seat. Call: 877-ORBBABY or visit [www.orbitbaby.com](http://www.orbitbaby.com). To receive new base w/ green circular seal, Toddler seat & Base must both be registered.

---

**PEG-PÉREGO** (last recall 3/14/08) 3625 Independence Dr, Fort Wayne, IN 46808, 800-671-1701, www.pegperegocom

---

**Infant Seats**

**Primo Viaggio SIP 30/30 made 7/1/07- 3/14/08 Models beginning "IMUN00US" 32MD41KN41, 35CR13BU13, 35CR13PL46, 35CR24BU24, 35TL49KN53, 35TL53KN46, 61ST13IC53, 61ST34IC53, & 61ST48IC53.** Plastic harness adjuster cover may have sharp edge that can cause cuts or scratches to bare legged infants. Call: 888-734-6030 for new adjuster cover.

---

**PHIL & TEDS** (no recalls) 800-839-4985 www.philandteds.com

---

**PORCHE** (Contact Britax)

---

**RECARO** (last recall 6/9/2015) 4120 Luella Lane Lane, Auburn Hills, MI 48326, 248-364-3818, www.recarousa.com

---

**Convertible Seats**

**ProRIDE model 332.01 made 4/9/10-6/9/15** in all colors (AK21, KAEC, KAEG, KK91, MC11, MJ15, QA56, QA9N, QQ11, QQ14, and QQ95) **Problem:** top tether anchorage may detach from the child restraint in a crash increasing risk of injury to child or vehicle occupants. Recaro will notify/send registered owners repair kit. Call: 866-628-4750 or email [recarorecall@m-s-s.com](mailto:recarorecall@m-s-s.com) for free retrofit kit.  
**Performance RIDE model 333.01 made 1/15/13-6/9/15** in all colors (CHIL, HABB, HAZE, JEBB, JETT, KNGT, MABB, MARI, MNGT, PLUM, PLBB, REBB, SLBB, REDD, ROBB, ROSE, SABB, SAPH, SLTE, VIBB, VIBE). **Problem:** top tether anchorage may detach from the child restraint in a crash increasing risk of injury to child or vehicle occupants. Recaro will notify/send registered owners repair kit. Call: 866-628-4750 or email [recarorecall@m-s-s.com](mailto:recarorecall@m-s-s.com) for free retrofit kit.  
**Como All models made 11/1/07-2/16/09 Problem #1:** Harness may not tighten/lock properly. In crash child may not be securely restrained & sustain injury. **Inspect seat:** Take empty seat & pull on harness adjuster strap to fully tighten harness. Next, pull on both shoulder straps without lifting/pressing harness release lever. If straps loosen, immediately stop using seat & Call: 888-473-2290 for replacement. If harness straps stay tight continue using seat. **Problem #2: All models made pre-12/18/07.** Harness can disconnect from harness connector (splitter plate) as child is taken in/out of seat. In crash, unsecured child can be injured. Call: 800-873-2276 for rubber caps to close gap allowing harness to disconnect.  
**Signo All models made 11/1/07-2/16/09 Problem #1:** Harness may not tighten/lock properly. In crash child may not be securely restrained & sustain injury. **Inspect seat:** Take empty seat & pull on harness adjuster strap to fully tighten harness. Next, pull on both shoulder straps without lifting/pressing harness release lever. If straps loosen, immediately stop using seat & Call: 888-473-2290 for replacement. If harness straps stay tight continue using seat. **Problem #2: All models made pre-12/18/07** Harness can disconnect from harness connector (splitter plate) as child is taken in/out of seat. In crash, unsecured child can be injured. Call: 800-873-2276 for rubber caps to close gap allowing harness to disconnect.

---

**Combination Seats**

**ProSport model 385 made 6/16/10-1/31/13 Problem:** when installed with lower anchors and no tether, the child's head can move too far forward, increasing risk of injury. For child weighing 40 or more pounds, seat belt must be used for installation. **Call: 888-973-2276** to obtain label and new instructions.

---

**REGAL LAGER** (see Cybex)

---

**SAFE TRAFFIC SYSTEM INC.** (No Recalls) 3343 W Eastwood Ave, Chicago, IL 60625, 847-329-8111, www.safetrafficsystem.com

---

**SAFEGUARD** (No Recalls) 18881 US 31 North, Westfield, IN 46074, 800-586-7839, www.safeguardseat.com

---

**SAFELINE KIDS** (See Tripleplay)

---

**SAFETY ANGEL/SAFE START** (No Recalls) PO Box 740151, Boynton Beach, FL 33474, 888-743-3798, www.safetyangel.com

---

**SAFETY BABY** (see Team Tex)

---

**SAFETY 1ST** (See Dorel)

---

**SIMPLE PARENTING** (no recalls) 862-240-1755 http://simpleparenting.co

---

**SNUGLI** (See Evenflo) 800-374-3603 www.snugli.com

---

**SUNSHINE KIDS** (See Diono)

---

**TEAM-TEX AMERICA** (last recall 12/18/2008) PO Box 3194 Rock Hill, SC 29732, 877-912-1313

**Infant Seat**

**Baby Ride made 12/18/08 model 374199 Problem #1:** Belt routing label w/ horizontal reference line is incorrectly placed on seat causing seat to be overly reclined. **Call:** 877-912-1313 for label & placement instructions.

---

**TEUTONIA USA** (No Recalls) 150 Oaklands Blvd, Exton, PA 19341, 877-838-8664, www.teutoniausa.com

---

**THE FIRST YEARS** (See Tomy International)

---

**THORLEY INDUSTRIES** (See 4Moms)

---

**TOMY INTERNATIONAL** 2021 9<sup>TH</sup> St. SE, Dyersville, Iowa 52040, 888-899-2229, www.tomy.com

---

**TRIPLE PLAY PRODUCTS** (last recall 5/5/2008) 10275 Wayzata Blvd, Suite 280, Minnetonka, MN 55305, 800-829-1625, www.tripleplayproducts.com

---

**Convertible Seats**

**Sit 'n' Stroll made 5/5/08 Model 4002 Problem #1:** Harness adjuster webbing fails to meet strength requirements, may cause child to be improperly restrained in a crash. **Call:** 800-829-1625 for repair kit with replacement harness adjuster strap.

---

**UPPA BABY** (No Recalls) 60 Sharp Street, Hingham, MA 02043 781-413-3030, www.uppababy.com

---

**URBINI** (No Recalls) 888-569-7288 www.urbinibaby.com

---